

TEST REPORT

Report No.: HL30193/2007

Page:

of

Date:

MAR. 15, 2007

FUH SHYAN CO., LTD.

No.27, Cherng Gong One St., Boh Doou Tsuen, Min Shyong Hsiang, Chia Yi, Taiwan, R.O.C.

The following merchandise was submitted and identified by the applicant as:

Product Description:

Chair Base

Style/Item No.:

B350

Manufacturer/Vendor:

FUH SHYAN CO., LTD.

Country of Origin:

Taiwan

We have tested the submitted sample(s) as requested and the following results were obtained:

Test Requested:

Sect. 7 Base Test - Static of ANSI/BIFMA X5.1-2002

Test Method:

- 1) Place the base on a test platform with blocks under base arms.
- 2) A force of 11,120N (2,500 lbf) shall be applied for 1 minute.
- 3) Remove the force.
- 4) Apply a second force of 11,120N (2,500 lbf) for 1 minute.
- 5) Remove the load and evaluate the product in accordance with the acceptance level Section 7.5.
- 6) Increase the load until the chair base is broken. (Requested by the client).

Test Results:

Sample	Broken load	Result	Remark
B350	3177.68 lbf	Pass	Maximum broken load.

^{*}The max. broken load is for reference only.

Conclusion:

In our opinion, the submitted sample complies with Sect. 7 of

ANSI/BIFMA X5.1-2002 for General - Purpose Office Chair.

Testing period:

2007/03/13 ~ 2007/03/15

Signed for and on behalf of SGS Taiwan Ltd.

Owen Cheng

This rest Report is issued by the Company subject to its General Conditions of Service printed overleat or available on request and accessive at with Attention is drawn to the limitations of liability, indemnification and jurisdictional issues defined therein. Unless otherwise stated the results shown in the refer only to the sample(s) tested. This test report cannot be reproduced, except in full, without prior written permission of the Company. Any unauthorize forgery or falsification of the content or appearance of this report is unlawful and offenders may be prosecuted to the fullest extent of the law. 此ि我是是这么证明的,此一个是一个专家的,我们可以通过的一个专家的,我们可以通过的一个专家的。

TW4378695

台灣檢驗科技股份有限公司 t (886-2) 2298-3355

SGS Taiwan Ltd. No. 33, No. 35, Wu Chyuan Hoad, Wuku Industral Zone, Taipei County, Taiwan./台北縣五股工業區五權路33號,35號



TEST REPORT


Report No.: HL30193/2007

Page:


2

of 2

- Picture Page -

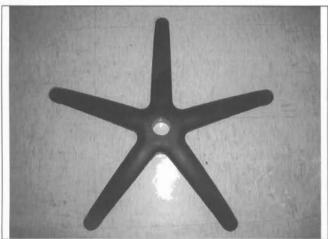

"Photo A"- Sample Picture

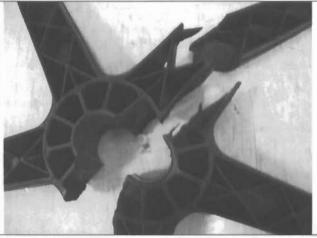

"Photo B"- After Test

---End of Report---